YOUR ONESURVEY HOME REPORT

ADDRESS

2 Post Office Cottages
Dulnain Bridge
PH26 3LT

PREPARED FOR

Kenneth Taylor

INSPECTION CARRIED OUT BY:



SELLING AGENT:



HOME REPORT GENERATED BY:



Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
Single Survey	Final	D M Hall - Inverness	26/02/2024
Mortgage Certificate	Final	D M Hall - Inverness	26/02/2024
Property Questionnaire	Final	Mr. Kenneth Taylor	21/02/2024
EPC	Final	D M Hall - Inverness	26/02/2024

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is essential that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

PART 1

SINGLE SURVEY

A report on the condition of the property, with categories being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	IS240267
Customer	Mr. Kenneth Taylor
Selling address	2 Post Office Cottages Dulnain Bridge PH26 3LT
Date of Inspection	22/02/2024
Prepared by	Calum Riach, MRICS D M Hall - Inverness

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

 \square

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller:
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- ➤ *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	The subjects comprise a Detached Bungalow of modern style.
Accommodation	Ground Floor: Living Room, Kitchen/Diner, Two Bedrooms, and Shower Room.
Gross internal floor area (m2)	62 m2.
Neighbourhood and location	The subjects are situated in a backlying position behind the Post Office/shop within Dulnain Bridge.
	Surrounding properties are generally of a similar residential nature. Local facilities and amenities are available nearby.
Age	Built circa 2017.
Weather	Dry and bright.
Chimney stacks	Visually inspected with the aid of binoculars where required.
	None.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where required.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Flat roofs have a limited life and depending on their age and

quality of workmanship can fail at any time. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of pitched design clad in concrete tiles with metal clad valleys and tiled ridging. Access to the roof void is via a ceiling hatch and sliding aluminium ladder within the hallway. The roof is of timber framed construction incorporating sterling board sarking. Insulation material has been laid between the ceiling joists. Rainwater fittings Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Main walls Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of pitched design clad in concrete tiles with metal clad valleys and tiled ridging. Access to the roof void is via a ceiling hatch and sliding aluminium ladder within the hallway. The roof is of timber framed construction incorporating sterling board sarking. Insulation material has been laid between the ceiling joists. Rainwater fittings Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Main walls Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
clad valleys and tiled ridging. Access to the roof void is via a ceiling hatch and sliding aluminium ladder within the hallway. The roof is of timber framed construction incorporating sterling board sarking. Insulation material has been laid between the ceiling joists. Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Main walls Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
aluminium ladder within the hallway. The roof is of timber framed construction incorporating sterling board sarking. Insulation material has been laid between the ceiling joists. Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Main walls Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
sterling board sarking. Insulation material has been laid between the ceiling joists. Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Rainwater fittings Visually inspected with the aid of binoculars where required. Gutters and downpipes are formed in UPVC. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Gutters and downpipes are formed in UPVC. Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Windows, external doors and joinery Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Foundations and concealed parts were not exposed or inspected. The main walls are of 340mm cavity timber framed construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
construction with an outer leaf of concrete blockwork externally roughcast. Windows, external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Doors and windows were not forced open. Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
Windows are of timber casement design equipped with sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
sealed unit double glazing. Access door is formed in timber and incorporates a glazed panel insert. Fascia and soffits are formed in timber with a varnished finish.
panel insert. Fascia and soffits are formed in timber with a varnished finish.
finish.
External decorations Visually inspected
Visually inspected.

	Varnished finishes.
Conservatories /	Visually inspected.
porches	None.
Communal areas	Circulation areas visually inspected.
	None.
Garages and	Visually inspected.
permanent outbuildings	There is a small metal storage shed.
Outside areas and boundaries	Visually inspected.
boundarios	Gardens grounds are on all sides laid to gravel with a raised timber deck seating area.
	Boundaries are defined to the rear by post and wire fencing.
	It should be confirmed whether there is vehicular parking within the Title.
Ceilings	Visually inspected from floor level.
	Ceilings are lined in plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are lined in plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.

	Flooring throughout is of solid concrete construction.	
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.	
	Kitchen units were visually inspected excluding appliances.	
	There is a stainless steel sink unit together with a range of floor and wall mounted storage units within the kitchen.	
	Skirtings and architraves are formed in timber with a varnished finish and internal doors are of timber panel or of timber and glazed design.	
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out.	
	None.,	
Internal decorations	Visually inspected.	
	Painted and papered finishes.	
Cellars	Visually inspected where there was safe and purpose-built access.	
	None.	
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.	
	Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.	
	Mains supply with the meter and consumer unit located within the hallway cupboard.	
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances.	
	Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.	
	No supply.	

Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is from a mains supply.
	The shower room is fitted with a WC, wash hand basin and shower cubicle with mixer fitting.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Heating and hot water is from a Mitsubishi Air Source Heat Pump located to the rear of the property. This supplies underfloor heating throughout the property.
	There is an insulated hot water tank with dual immersion heaters within the hallway cupboard.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Drainage is connected to the main public sewer. I did not lift any hatches or view chambers.
Fire, smoke and burglar alarms	Visually inspected.
diamis	No test whatsoever were carried out to any systems or appliances.
	There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.
	The surveyor will only comment on the presence of a smoke

detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.

We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.

An interlinked smoke detector system was noted. There is also a carbon monoxide detector fitted.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated.

If no inspection was possible, the Surveyor will assume that there are no defects that will have a material effect on the valuation

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the Surveyor is able to give an opinion on the general condition and standard of maintenance.

An inspection for Japanese Knotweed was not carried out.

This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property.

Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My physical inspection of the roof void area was restricted due to insulation material, and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.

My inspection of the roof covering was restricted from ground level and some parts were not visible.


Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of

is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

Sectional Diagram showing elements of a typical house

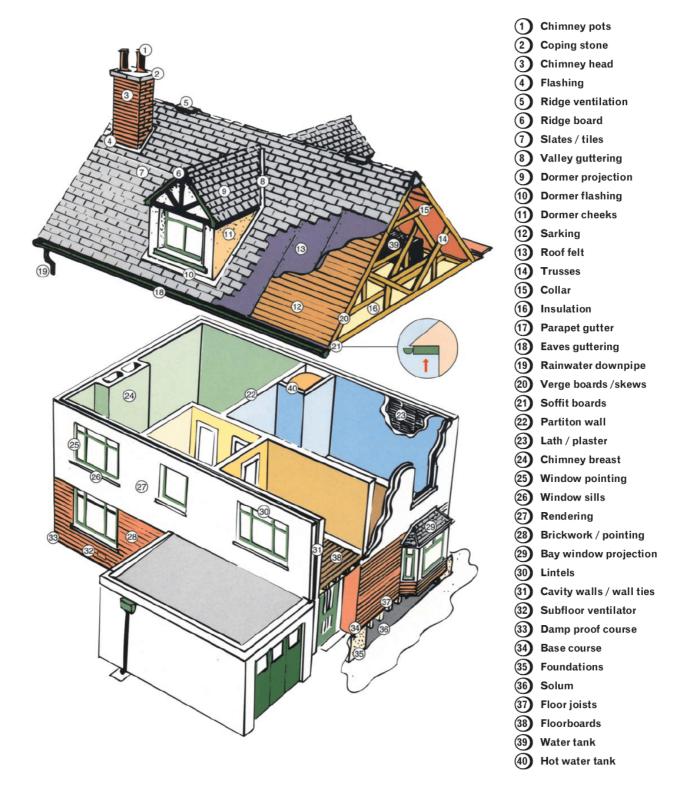

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	No obvious evidence of significant movement noted within the limitations of my inspection.

Dampness, rot and infestation	
Repair category:	
Notes:	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks	
Repair category:	
Notes:	None.

Roofing including roof space	
Repair category:	
Notes:	No significant defects noted.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings	
Repair category:	
Notes:	There is seepage evident at joints.

Main walls	
Repair category:	2
Notes:	The rendering of outer walls is cracked and bossed in places and can be repaired or replaced by a competent local builder.

Windows, external doors and joinery	
Repair category:	
Notes:	No significant defects noted.

External decorations	
Repair category:	
Notes:	No significant defects noted.

Conservatories / porches	
Repair category:	
	None.

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

repairs of replaceri	ient are needed now.
Notes:	
Communal areas	
Repair category:	
Notes:	None.
Garages and per	manent outbuildings
Repair category:	1
Notes:	No significant defects noted.
Outside areas ar	nd boundaries
Repair category:	1
Notes:	No significant defects noted.
Ceilings	
Repair category:	

There is shrinkage cracking evident.

lo:	tor	na	1 14	10	
ш	ᄕᅜᅵ	Пd	ı۷۱	ıaı	15

Notes:

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	1
Notes:	No significant defects noted.

Floors including	sub-floors
Repair category:	1
Notes:	There is lifting to vinyl laminate flooring within the kitchen and living room.

Internal joinery and kitchen fittings	
Repair category:	
Notes:	No significant defects noted.

Chimney breasts and fireplaces		
Repair category:		
Notes:	None.	

Internal decorations	
Repair category:	
Notes:	No significant defects noted.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars		
Repair category:		
Notes:	None.	

Electricity		
Repair category:		
Notes:	No significant defects noted.	
	It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.	

Gas		
Repair category:		
Notes:	None.	

Water, plumbing and bathroom fittings	
Repair category:	
Notes:	No significant defects noted.

survey report

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot water		
Repair category:	1	
Notes:	It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.	

Drainage	
Repair category:	
Notes:	No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	
Roofing including roof space	1
Rainwater fittings	1
Main walls	2
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres:</u> For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	[x]YES []NO
3. Is there a lift to the main entrance door of the property?	[]YES [x]NO
4. Are all door openings greater than 750mm?	[x]YES []NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES []NO
6. Is there a toilet on the same level as a bedroom?	[x]YES []NO
7. Are all rooms on the same level with no internal steps or stairs?	[x]YES []NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES []NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

The boundary of the property Title should be confirmed by a Legal Representative.

The access is shared. The completing conveyancer should verify rights of access and liability in respect of future maintenance.

Estimated re-instatement cost (£) for insurance purposes

160.000

ONE HUNDRED AND SIXTY THOUSAND POUNDS. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation (£) and market comments

190.000

ONE HUNDRED AND NINETY THOUSAND POUNDS.

Against a backdrop of changing economic circumstances and increasing interest rates, it is not possible to predict how the market will perform in the coming months although market conditions continue to be stable at present.

Report author:	Calum Riach, MRICS
Company name:	D M Hall - Inverness
Address:	Hope House Castlehill Drive Inverness IV2 5GH
Signed:	Electronically Signed: 250857-878aa635-1c8d
Date of report:	26/02/2024

P A R T 2.

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report							
Property:	2 Post Office						
	Dulnain Bridge PH26 3LT	9	Tenure: Absolute Ownership				
Date of Inspection:	22/02/2024		Reference: IS240267				
This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.							
1.0	1.0 LOCATION						
The subjects	are situated in a	backlying posit	ion behind the I	Post Office/sho	p within Dulnair	Bridge.	
Surrounding p	properties are ge	enerally of a sim	ıilar residential ı	nature. Local fa	cilities and ame	nities are availa	able nearby.
2.0	DESCRIPTIO	DESCRIPTION 2.1 Age: Built circa 2017.					
The subjects comprise a Detached Bungalow of modern style.							
3.0	3.0 CONSTRUCTION						
The main walls are of cavity timber framed construction with an outerleaf of concrete blockwork externally roughcast. The roof is pitched and tiled.							
4.0	ACCOMMODATION						
Ground Floor: Living Room, Kitchen/Diner, Two Bedrooms, and Shower Room.							
5.0 SERVICES (No tests have been applied to any of the services)							
Water:	Mains	Electricity:	Mains	Gas:	None.	Drainage:	Mains
Central Heat	Air Source Heat Pump to underfloor heating.						
6.0	OUTBUILDINGS						

Garage:

None

Others:	Metal storage	shed.			
7.0	GENERAL CONDITION - A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.				
	was found to be in a condition of normal routine maintenance.	commensurate v	vith age and type. Most items o	of repair should	be capable of
	of maintenance or repair have b f these issues prior to making a			emselves as to	the costs and
The boundary	of the property Title should be	confirmed by a	Legal Representative.		
The access is maintenance.	shared. The completing conve	yancer should v	erify rights of access and liabil	ity in respect of	future
8.0	ESSENTIAL REPAIR WORK property)	((as a conditior	of any mortgage or, to preser	ve the condition	of the
None.					
8.1 Retention	recommended:	None.			
9.0	ROADS &FOOTPATHS				
Adopted.					
10.0	BUILDINGS INSURANCE (£):	160,000	GROSS EXTERNAL FLOOR AREA	71 m2	Square metres
	should be insured against total property in its existing design allowance has been included	al destruction or and materials. for inflation dur	m for which the property and so n a re-instatement basis assum Furnishings and fittings have n ing the insurance period or dur n on professional fees. Further	ning reconstruct ot been include ing re-construct	ion of the d. No tion and no
11.0	GENERAL REMARKS				
	of maintenance or repair have b f these issues prior to making a			emselves as to	the costs and
The boundary	of the property Title should be	confirmed by a	Legal Representative.		
The access is maintenance.	shared. The completing conve	yancer should v	erify rights of access and liabil	ity in respect of	future
12.0	adverse planning proposals, necessary Local Authority co investigation of any contamin matters to be outwith the scoasbestos in one or more of its beyond the scope of this insp	onerous burden nsents, which n lation on, under pe of this report s components o pection to test fo	ossession and that the propert is, title restrictions or servitude hay have been required, have to or within the property has been in All property built prior to the y in fittings. It is impossible to ident if asbestos and future occupant to for a specialist to undertake a	rights. It is assumed in made as we come as we come as we come as we come at the without a test should be ad	umed that all dobtained. No consider such contain est. It is lyised that if
12.1	Market Value in present condition (£):	190,000	ONE HUNDRED AND NINE	TY THOUSAND	POUNDS.
12.2	Market Value on				
Post Office Co	ottages Dulnain Bridge PH26	3I T			Page 3

	completion of works (£):	of essential				
12.3	12.3 Suitable security for normal mortgage purposes?		Yes			
12.4	Date of Valua	ation:	22/02/2024			
Signature:		Electronically	v Signed: 250857-878aa635-1c8d			
Surveyor:	Calum Riach		MRICS Date : 26/02/2024		26/02/2024	
D M Hall - Inverness						
Office:	Office: Hope House Castlehill Drive Inverness IV2 5GH		Tel: 01463 241 077 Fax: email: inverness@dmhall.co.uk,p	aula.geegan@	dmhall.co.uk	

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	2 Post Office Cottages Dulnain Bridge PH26 3LT
Customer	Mr. Kenneth Taylor
Customer address	2 Post Office Cottages Dulnain Bridge PH26 3LT
Prepared by	Calum Riach, MRICS D M Hall - Inverness

Energy Performance Certificate (EPC)

Dwellings

Scotland

POST OFFICE COTTAGE, 2, DULNAIN BRIDGE, GRANTOWN-ON-SPEY, PH26 3LT

Dwelling type: Detached bungalow
Date of assessment: 22 February 2024
Date of certificate: 26 February 2024

Total floor area: 62 m²

Primary Energy Indicator: 210 kWh/m²/year

Reference number: 2714-3922-1530-2072-1226 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Air source heat pump, underfloor, electric

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,975	See your recommendations
Over 3 years you could save*	£780	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

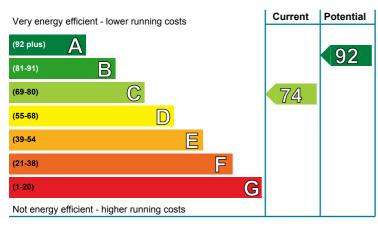


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (74)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

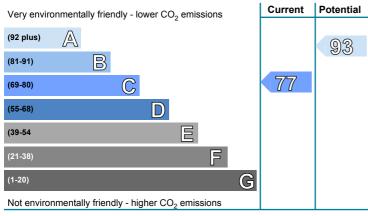

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (77)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar water heating	£4,000 - £6,000	£630.00
2 Heat recovery system for mixer showers	£585 - £725	£150.00
3 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1458.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	****
Roof	Pitched, 300 mm loft insulation	****	****
Floor	Solid, insulated (assumed)	_	_
Windows	Fully double glazed	★★★★ ☆	★★★★ ☆
Main heating	Air source heat pump, underfloor, electric	★★★★☆	****
Main heating controls	Programmer and at least two room thermostats	★★★★☆	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	***
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 35 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.2 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

POST OFFICE COTTAGE, 2, DULNAIN BRIDGE, GRANTOWN-ON-SPEY, PH26 3LT 26 February 2024 RRN: 2714-3922-1530-2072-1226 **Recommendations Report**

	Estimated	l energy costs	s for this home
--	-----------	----------------	-----------------

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,896 over 3 years	£1,902 over 3 years	
Hot water	£1,797 over 3 years	£1,011 over 3 years	You could
Lighting	£282 over 3 years	£282 over 3 years	save £780
Totals	£3,975	£3,195	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

December and ad management		Indicative cost	Typical saving	Rating after improvement		
Re	ecommended measures	Indicative cost per year		Energy	Environment	
1	Solar water heating	£4,000 - £6,000	£210	C 79	B 81	
2	Heat recovery system for mixer showers	£585 - £725	£50	C 80	B 82	
3	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£486	A 92	A 93	

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

2 Heat recovery system for mixer showers

A shower heat recovery system extracts heat from the water in the shower drain and transfers it to incoming cold water. This reduces the amount of energy needed per shower. Building regulations generally apply to this work, so it is best to check with your local authority building standards department and seek advice from a qualified plumber or heating engineer.

3 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

Air source heat pump

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	5,787	N/A	N/A	N/A
Water heating (kWh per year)	2,168			

POST OFFICE COTTAGE, 2, DULNAIN BRIDGE, GRANTOWN-ON-SPEY, PH26 3LT 26 February 2024 RRN: 2714-3922-1530-2072-1226 **Recommendations Report**

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Calum Riach
Assessor membership number: EES/018141

Company name/trading name:

Address:

D M Hall Chartered Surveyors LLP
Hope House Castlehill Drive

Hope House Castlehill Drive Cradlehall Business Park

Cradlehall Busi Inverness

Phone number: UV2 5GH
Phone number: 0131 477 6000
Email address: dmhall@dmhall.co.uk
Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

POST OFFICE COTTAGE, 2, DULNAIN BRIDGE, GRANTOWN-ON-SPEY, PH26 3LT 26 February 2024 RRN: 2714-3922-1530-2072-1226 **Recommendations Report**

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



PART 4.

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.





Property address	2 POST OPFICE COTTAGES DULNAIN BRIDGE
	GRANTON NON SPEY
	PH263LT

Mr KewnETH TAYLOR.
16 02.2024





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property?		
2.	Council tax		
	Which Council Tax band is your property in? (Please tick) A□ B□ C□ D□ E□ F□ G□ H□		
3.	Parking		
	What are the arrangements for parking at your property? (Please tick all that apply)		
	Garage		
	Allocated parking space		
	Driveway		
	Shared parking		
	On street		
	Resident permit		
	Metered parking		
	Other (please specify):		
4.	Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes No Don't know	
5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes No	
6.	Alterations/additions/extensions		
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example,	Yes	



	If you have answered yes, please describe below the changes which you have made:		
	*		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes No	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	Yes No	
	(iii) Please describe the changes made to the windows doors, or approximate dates when the work was completed): Please give any guarantees which you received for this work to estate agent.		
7.	Central heating	nash,	BEN SH
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes No Partial	
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	AIR.	SOURCU UMP
	If you have answered yes, please answer the three questions below:		
	i) When was your central heating system or partial central	201	8/19 appro



	1	
(ii) Do you have a maintenance contract for the central heating system? If you have answered yes, please give details of the company	Yes No	
with which you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year).		
Energy Performance Certificate		THE STATE
Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes No	
Issues that may have affected your property		
Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No	
If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No	
Are you aware of the existence of asbestos in your property?		
If you have answered yes, please give details:	Yes No	
	If you have answered yes, please give details of the company with which you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim? Are you aware of the existence of asbestos in your property?	If you have answered yes, please give details of the company with which you have a maintenance contract: (iii) When was your maintenance agreement last renewed? (Please provide the month and year). Energy Performance Certificate Does your property have an Energy Performance Certificate which is less than 10 years old? Issues that may have affected your property Has there been any storm, flood, fire or other structural damage to your property while you have owned it? If you have answered yes, is the damage the subject of any outstanding insurance claim? Yes No Yes No Yes No Yes No Yes No Are you aware of the existence of asbestos in your property? Yes



10.	Services				
a. Ple suppli	ease tick which services are er:	connected to your prope	erty and give d	letails of the	
Servi	ces	Connected	Supplier		Ī
Gas	or liquid petroleum gas				
	r mains or private supply				
Elect	ricity				
Mains	s drainage				
Telep	hone				
Cable	TV or satellite				
Broad	dband				
			1		
b.	Is there a septic tank syst If you have answered yes, below:		uestions	Yes No	
	(i) Do you have appropriate your septic tank?	te consents for the discha	arge from	Yes No Don't know	
	(ii) Do you have a mainter	nance contract for your se	eptic tank?	Yes	Ħ
	If you have answered yes with which you have a ma	•	e company	No	Ц
11.	Responsibilities for share	d or common areas			
a.	Are you aware of any responsible anything used jointly, such road, boundary, or garden	as the repair of a shared o		Yes No Don't know	
	If you have answered yes,	please give details:			
b.	Is there a responsibility to the roof, common stairwell	or other common areas?	aintenance of	Yes No Don't know	D
	If you have answered yes,	piease give details:			
C.	Has there been any major r		y part of the	Yes	



d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Yes No	9
	If you have answered yes, please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes No	
	If you have answered yes, please give details:	SHARED DRIVE"	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	Yes No	
12.			
a.	Charges associated with your property Is there a factor or property manager for your property?	Yes	
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	No	
b.	Is there a common buildings insurance policy?	Yes	
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No Don't know	<u>U</u>
C.	Please give details of any other charges you have to pay on a regul upkeep of common areas or repair works, for example to a resident maintenance or stair fund.		r
13.	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes No	
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes No	4
b.	If you have answered yes, please give details:	110	



C.	If you have answered yes to 13(a) or (b), guarantees relating to this work? If you have answered yes, these guarant purchaser and should be given to your spossible for checking. If you do not have solicitor or estate agent will arrange for will also need to provide a description of This may be shown in the original estimated. Guarantees are held by:	ees will be olicitor as them you them to be f the work	needed soon as rself and obtained	your I. You	Yes No			
14.	Guarantees		istre vi					
a.	Are there any guarantees or warranties for any of the following:							
		No	Yes	Don't know	With title deeds	Lost		
(i)	Electrical work			8				
(ii)	Roofing							
(iii)	Central heating							
(iv)	National House Building Council (NHBC)			0				
(v)	Damp course							
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)							
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):							
C.	Are there any outstanding claims under any of the guarantees listed above?				Yes No	I.		
	If you have answered yes, please give details:				N/A			
15.	Boundaries							
	So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:				Yes No Don't know			
16.	Notices that affect your property							
	In the past three years have you ever received a notice:							
a.	advising that the owner of a neighbour planning application?	ring prope	rty has n	nade a	Yes No			



b.	that affects your property in some other way?	Yes No	4			
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes No				
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.					

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): P.O. A KIRTAYLOR (SON)

Date: 16.02, 2024

